

N/O2/MIP - Data Sheet



Overview

The N/O2/MIP Miniature Heavy Duty Magnetic Proximity Sensor is a general purpose position or movement sensor. Do not use in safety related applications.

Principles of operation and use

The N/O2/MIP is a normally open reed switch based sensor that closes when in the presence of a magnetic actuator. The non contact operation of these sensors make them suited to applications where misalignment or contamination from dust and solids are a concern. When mounted on or near ferrous surfaces the operating distance will be reduced. Avoid close proximity to strong magnetic fields i.e. electric motors and solenoids. The switch may be operated through a non ferrous skin such as non magnetic stainless steel, plastic, aluminium and non ferrous castings etc. possibly enabling the switch and its connections to be inside part of a housing or machine. N/O2/MIP sensors may be operated from three sides.

Loads

Maximum ratings in the "Specification and ratings" are for dc voltage and resistive loads. Protect against inductive, capacitive or reactive loads. For maximum contact life and reliability, ensure the ratings are not exceeded. Contact our technical department for advice on specific loads.


Fitting and adjustment

When considering fixing positions refer to "Principles of operation and use". Ensure vibration and shock limits will not be exceeded both in normal and in any foreseen abnormal operation. To help reduce the effects of vibration or shock the sensor unit may be mounted on a rubber pad or foam tape. The switch and actuator should not be fixed so that they slide longitudinally against each other as multiple operations may occur; they should be mounted so that that switch and actuator move parallel to each other, see "Operating positions". When adjusting the N/O2/MIP sensor for maximum operation distance it is recommended that it is magnetically overdriven by at least 25% i.e. With an application that gives a maximum operating distance of 16 mm it should be considered that the maximum distance is actually 16 mm less 25% = 12 mm, therefore to operate the sensor correctly the actuator magnet should be within 12 mm of the switch. Consideration should be given to the safe routing of the connecting cable, avoid tight bends and allow a minimum of 50mm of straight cable from the sensor housing before any bends. See "Schematic diagram" for electrical connections; check the contact ratings are not exceeded.

Maintenance

To clean wipe with a damp cloth, do not immerse in water or cleaning fluid. The N/O2/MIP sensor should be routinely checked for correct operation.

Dimensions

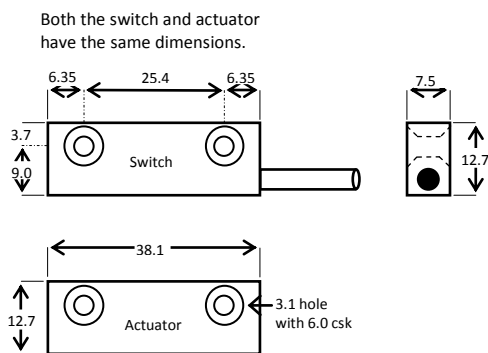


Order Codes

Type	Description
N/O2/MIP	Normally open heavy duty magnetic proximity sensor
AM/4	Standard magnetic actuator
AM/8	Extra power magnetic actuator


Specifications and ratings

Specification	N/O2/MIP
Contact form	N/O normally open
Max contact rating	12 VA do not exceed product of voltage x amps
Max switching voltage	75 Vdc
Max switching current	1 Amps dc resistive
Max carry current	1 Amps dc resistive
Minimum breakdown voltage	300 Vdc
Capacitance	0.5 pF
Contact resistance	100 mΩ
Temperature range	-10 to +70 °C
Max vibration	35 G's 50-2000 hertz's
Max Shock	50 G's 11ms ½ sine wave
Resonate frequency	2,900 Hz
Max operating frequency	200 Hz
Pull in time	2.5 ms
Release time	0.1 ms
Environmental protection	IP65
Operating distance AM/4	make 9mm release 18mm nominal
Operating distance AM/8	make 18mm release 27mm nominal
Cable	0.5M black 7-2-2A DEF61-12
Connections	Blue = com, red = n/o
Housing material	Diecast zinc

Operating positions

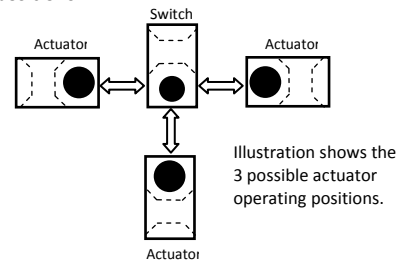

Schematic diagram

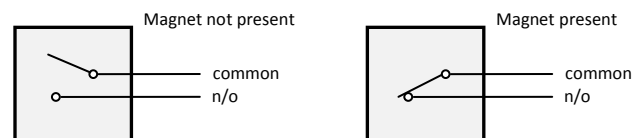

Image



To the best of our knowledge the Information contained in this data sheet is accurate. Arun Electronics Ltd disclaims any and all liability whatsoever for any of the purchaser's reliance on the information contained in this data sheet. The purchaser should test for himself the products detailed in this data sheet to ensure their suitability for his application.

Arun Electronics Ltd, Unit B Heath Place, Ashgrove Industrial Park, Bognor Regis
West Sussex. PO22 9SL UK
Tel +44 (0)1243 867854 Fax +44 (0)1243 867886
www.arun-electronics.co.uk

